View NSN Online: https://aerobasegroup.com/nsn/3439-00-955-1823

ALPHA METALS -- ENERGIZED ROSIN CORE SOLDER (0.015" DIA.) -- 3439-00-955-1823

======== Product Identification ============

Product ID:ENERGIZED ROSIN CORE SOLDER (0.015" DIA.)

MSDS Date:06/27/1986

FSC:3439

NIIN:00-955-1823

MSDS Number: BHXFD === Responsible Party === Company Name:ALPHA METALS

Address:600 ROUTE 440

City:JERSEY CITY

State:NJ ZIP:07304 Country:US

Info Phone Num:201-434-6778

Emergency Phone Nu

m:800-424-9300 (CHEMTREC)

CAGE:96613

=== Contractor Identification ===

Company Name: FRYS METALS INC (FORMER ALPHA METALS)

Address:600 ROUTE 440 Box:City:JERSEY CITY

State:NJ ZIP:07304 Country:US

Phone:201-434-6778

CAGE:96613

====== Composition/Information on Ingredients ========

Ingred Name: LEAD (SARA III)

CAS:7439-92-1

RTECS #:OF7525000

OSHA PEL:0.05 MG/M3;1910.1025 ACGIH TLV:0.15 MG/M3;DUST 9192

EPA Rpt Qty:1 LB DOT Rpt Qty:1 LB

Ingred Name:TIN CAS:7440-31-5

RTECS #:XP7320000

OSHA PEL:2 MG/M3 ACGIH TLV:2 MG/M3; 9192

Ingred Name: SILVER (SARA III)

CAS:7440-22-4

RTECS #:VW3500000 OSHA PEL:0.01 MG/M3 ACGIH TLV:0.1 MG/M3; 9192

EPA Rpt Qty:1 LB DOT Rpt Qty:1 LB

Ingred Name:BISMUTH

CAS:7440-69-9

RTECS #:EB2600000

Ingred Name: ANTIMONY (SARA III)

CAS:7440-36-0

RTECS #:CC4025000

OSHA PEL:0.5 MG/M3

ACGIH TLV:0.5 MG SB/M3; 9192

EPA Rpt Qty:5000 LBS DOT Rpt Qty:5000 LBS

Ingred Name:INDIUM CAS:7440-74-6

RTECS #:NL1050000 OSHA PEL:0.1 MG/M3

ACGIH TLV:0.1 MG/M3; 9192

Ingred

Name:ROSIN ACID CAS:8050-09-7 Fraction by Wt: 1-4% ACGIH TLV:0.10 MG/CUM

========== Hazards Identification ===============


LD50 LC50 Mixture:LD50 (ORAL RAT) IS >5000 MG/KG (ROSIN)

Routes of Entry: Inhalation:YES Skin:NO Ingestion:NO Reports of Carcinogenicity:NTP:NO IARC:NO OSHA:NO

Health Hazards Acute and Chronic:ACUTE: INHALE: IN MOLTEN STATE, ROSIN

FUMES CAN CAUSE RESPIRATORY IRRITATION, DIZZINESS, HEADACHE. LEAD

COULD CAUSE ANEMIA, INSOMNIA, WEAKNESS, CONSTI

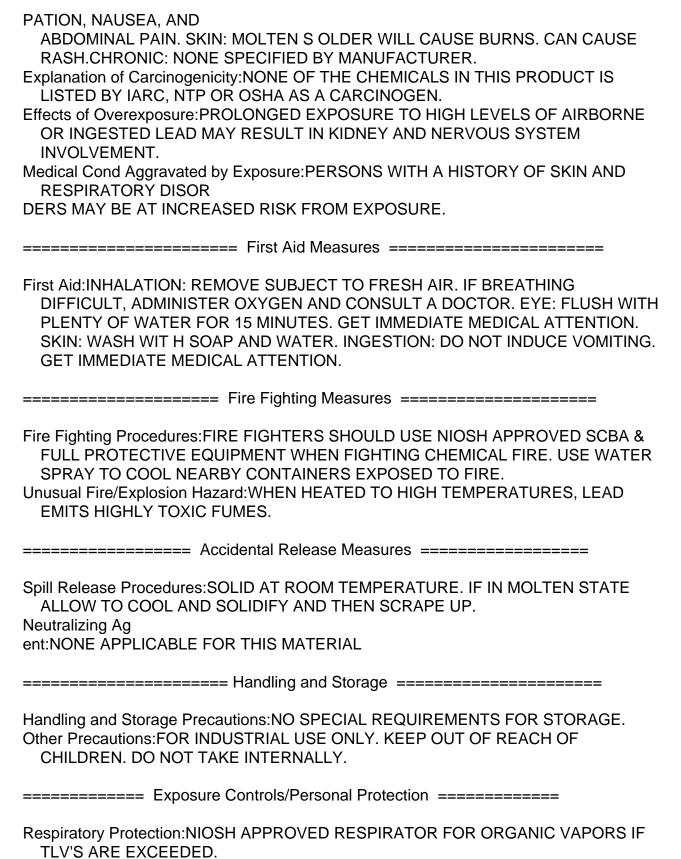

Ventilation: PROVIDE SUFFICIENT MECHANICAL (GENERAL AND

/OR LOCAL EXHAUST) VENTILATION TO MAINTAIN EXPOSURE LEVELS BELOW TLV'S. Protective Gloves: NOT USUALLY NECESSARY. Eye Protection: FACE SHIELD/EYE GOGGLES WHEN SOLDERING. Other Protective Equipment: NOT USUALLY NECESSARY. Work Hygienic Practices: WASH THROUGHLY AFTER HANDLING AND BEFORE EATING. NO EATING, DRINKING, SMOKING, OR APPLYING COSMETICS AROUND SOLDER USE. Supplemental Safety and Health SINCE EMPTY CCONTAINERS MAY RETAIN PRODUCT RESIDUES ALL LABELED HAZARD PRECAUTIONS MUST BE OBSERVED. ========= Physical/Chemical Properties =========== HCC:N1 Solubility in Water: INSOLUBLE Appearance and Odor: SILVER-GRAY METAL WIRE, ODORLESS, VARIOUS SHAPES AND SIZES. ======== Stability and Reactivity Data =========== Stability Indicator/Materials to Avoid:YES OXIDIZING MATERIALS, STRONG ACIDS. Stability Condition to Avoid:NONE Hazardous Decomposition Products: THE SMOKE FROM SOLDERING OPERATION MAY INCLUDE SUCH COMPOUNDS AS CARBON MONOXID E, ABIETIC ACID, ALIPHATIC ALDEHYDES.

====== Disposal Considerations ===========

Waste Disposal Methods:THE ALLOY PORTION IS RECLAIMABLE. DISPOSE OF IN ACCORDANCE WITH ALL APPLICABLE FEDERAL, STATE AND LOCAL LAWS AND REGULATIONS.

Disclaimer (provided with this information by the compiling agencies): This information is formulated for use by elements of the Department of Defense. The United States of America in no manner whatsoever, expressly or implie

d, warrants this information to be accurate and disclaims all liability for its use. Any person utilizing this document should seek competent professional advice to verify and assume responsibility for the suitability of this information to their particular situation.