View NSN Online: https://aerobasegroup.com/nsn/5330-00-758-2883 DETROIT DIESEL CORP -- 5124796 -- 5330-00-758-2883 Product ID:5124796 MSDS Date:12/09/1992 FSC:5330 NIIN:00-758-2883 MSDS Number: BPMTJ === Responsible Party === Company Name: DETROIT DIESEL CORP Address:13400 W OUTER DR /SPEED CODE N-53/ City:DETROIT State:MI ZIP:48239-4001 Country:US Info Phone Num:313-592-5100 Emergency Phone Num:313-592-5100 Preparer's Name:H MIS TECHNICIAN CAGE:72582 === Contractor Identification === Company Name: DETROIT DIESEL CORP, CORPORATE HQ Address:13400 W OUTER DR /SPEED CODE N-53/ Box:City:DETROIT State:MI ZIP:48239-4001 Country:US Phone:313-592-5100/5665 CAGE:72582 ======= Composition/Information on Ingredients ========

Ingred Name: ASBESTOS, CHRYSOTILE CAS: 12001-29-5

RTECS #:Cl6478500

Other REC Limits: NONE RECOMMENDED

OSHA PEL:0.2 FIBERS/CC

ACGIH TLV:2 FIBERS/CC; A1;9293

====== Hazards Identi

fication						
TICATION	 	 	 	 	 	

Routes of Entry: Inhalation:YES Skin:NO Ingestion:NO

Health Hazards Acute and Chronic:ACUTE:MINOR EYS/SKIN IRRITATION.
INGESTION- IRRITATION OF GI TRACT. INHALATION-IRRITATION OF

RESPIRATORY TRACT. CHRONIC: ASBESTOSIS, LUNG CANCER, & MESOTHELIOMA, ALL OF WHICH ARE DISABLING AND FATAL D ISEASES OF THE LUNG. INHALATION AND INGESTION OF ASBESTOS FIBERS MAY CAUSE CANCER OF THE BOWEL.

Expl

anation of Carcinogenicity:ASBESTOS IS A KNOWN HUMAN CARCINOGEN.
Effects of Overexposure:INHALATION: FATIGUE AND SHORTNESS OF BREATH
THAT GETS WORSE WITH TIME AND EVENTUALLY BECOMES DISABLING. EYES:
IRRITATION. SKIN: IRRITATION. INGESTION: MILD STOMACH DISTRESS.
DIARRHEA, VOMITING, AND NA USEA.

Medical Cond Aggravated by Exposure: ASTHMA, EMPHYSEMA, AND TUBERCULOSIS ARE ALL GENERALLY AGGRAVATED BY EXPOSURE TO ASBESTOS FIBERS.

 First Aid Measures	=======

First Aid:INHALATION: REMOVE TO FRESH AIR. SEE DOCTOR. EYES: RINSE THOROUGHLY WITH WATER FOR 15 MINUTES. SEE DOCTOR. SKIN: WASH THOROUGHLY WITH SOAP AND WATER. IF IRRITATION PERSISTS, SEE DOCTOR. INGESTION: DIL UTE WITH WATER. DO NOT INDUCE VOMITING.SEE DOCTOR.

========== Fire Fighting Measures ===============

Flash Point: NOT REQUIRED

Extinguishing Media: USE WATER FOG, CARBON DIOXIDE, FOAM, OR DRY CHEMICAL.

Fire Fighting Procedures:WEAR FIRE F


IGHTING PROTECTIVE EQUIPMENT AND A

FULL FACED SELF CONTAINED BREATHING APPARATUS.

Unusual Fire/Explosion Hazard: COMBUSTION OR HEAT OF FIRE MAY PRODUCE HAZARDOUS DECOMPOSITION PRODUCTS AND VAPORS.

======== Accidental Release Measures ===========

Spill Release Procedures: VACUUM THE MATERIAL WITH A HEPA FILTERED VACUUM. THE EQUIPMENT SHALL BE USED & EMPTIED SO AS TO MINIMIZE THE RE-ENTRY OF ASBESTOS INTO THE WORKPLACE. OTHERWISE, WET THE MATERIAL WITH WATER

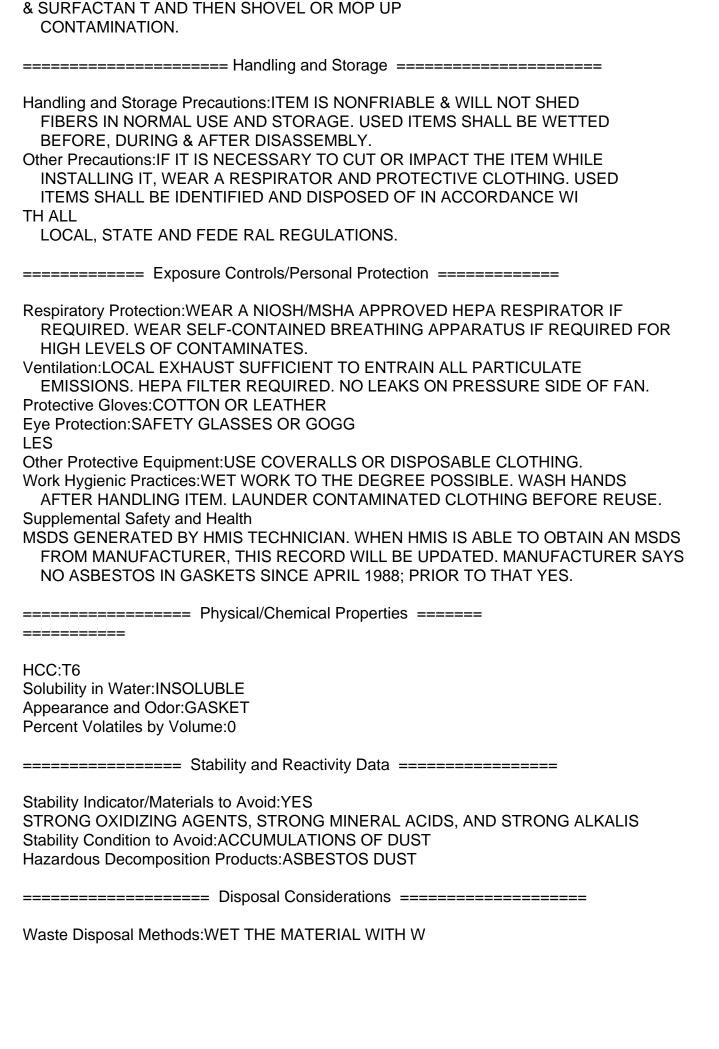

ATER AND SURFACTANT.

PLACE IN 6 MIL THICK POLYETHYLENE PLASTIC BAG. PLACE THESE BAGS INTO ANOTHER POLY BAG OR A SAFE PLACE UNTIL IT CAN BE SHIPPED TO AN APPROVED DISPOSAL SITE. IDENTIFY WITH ASBESTOS CANCER WARNING LABEL.

Disclaimer (provided with this information by the compiling agencies): This information is formulated for use by elements of the Department of Defense. The United States of America in no manner whatsoever, expressly or implied, warrants this information t o be accurate and disclaims all liability for its use. Any person utilizing this document should seek competent professional advice to verify and assume responsibility for the suitability of this information to their particular situation.