View NSN Online: https://aerobasegroup.com/nsn/6640-01-240-9960

BAXTER DIAGNOSTICS INC FMRLY TRAVENOL LAB -- MICROSCAN MINERAL OIL

6640-01-240-9960

============= Product Identification =================

Product ID:MICROSCAN MINERAL OIL

MSDS Date:01/23/1992

FSC:6640

NIIN:01-240-9960

MSDS Number: BVZKM === Responsible Party ===

Company Name: BAXTER DIAGNOSTICS INC FMRLY TRAVENOL LAB

Address:1584 ENTERPRISE BLVD

City:WEST SACRAMENTO

State:CA ZIP:95691 Country:US

Info Phone Num:91

6-374-3044/800-677-7226

Emergency Phone Num:916-374-3044

CAGE:0WG31

=== Contractor Identification ===

Company Name: BAXTER DIAGNOSTICS INC, MICROSCAN DIV/TRAVENOL LAB

Address:1584 ENTERPRISE BLVD Box:City:WEST SACRAMENTO

State:CA ZIP:95691 Country:US

Phone:916-374-3044

CAGE:0WG31

======= Composition/Information on Ingredients ========

Ingred Name: MINERAL OIL

CAS:8012-95-1

RTECS #:PY8030000 Fraction by Wt: 100% %

Other REC Limits: NONE RECOMMENDED

OSHA PEL:5 MG/M3 ACGIH TLV:5 MG/M3 (


MIST); 9394
========== Hazards Identification ============
LD50 LC50 Mixture:NOT GIVEN FOR PRODUCT AS A WHOLE Routes of Entry: Inhalation:YES Skin:NO Ingestion:NO Reports of Carcinogenicity:NTP:NO IARC:NO OSHA:NO Health Hazards Acute and Chronic:EXPOSURE TO DENSE OIL MIST RESULTS IN RESPIRATORY TRACT IRRITATION. PROLONGED EXPOSURE MAY CAUSE LIPID PNEUMONIA, ASTHMA, FIBROSIS. Explanation of Carcinogenicity:THIS COMPOUND CONTAINS NO INGREDIENTS AT CONCENTRA TIONS OF 0.1% OR GREATER THAT ARE CARCINOGENS OR SUSPECT CARCINOGENS. Effects of Overexposure:RESPIRATORY TRACT IRRITATION, PNEUMONIA, ASTHMA, FIBROSIS. Medical Cond Aggravated by Exposure:PERSONS WITH CHRONIC RESPIRATORY DISORDERS MAY BE AGGRAVATED BY EXPOSURE TO THIS PRODUCT.
======================================
First Aid:EYES: FLUSH WITH WATER FOR 15 MINUTES WHILE HOLDING EYELIDS OPEN. GET MEDICAL ATTENTION. SKIN: REMOVE CONTAMINATED CLOTHING.
WASH WITH SOAP AND WATER. IF IRRITATION PERSISTS, GET MEDICAL ATTENTION. IN HALATION: REMOVE TO FRESH AIR. RESTORE BREATHING. GET MEDICAL ATTENTION. INGESTION: DO NOT INDUCE VOMITING. GET MEDICAL ATTENTION. IF VOMITING OCCURS, KEEP HEAD BELOW HIPS.
======================================
Flash Point Method:CC Flash Point:295F,146C Lower Limits:NOT GIVEN Upper Limits:NOT GIVEN Extinguishing Media:CARBON DIOXIDE, DRY CHEMICAL Fire Fighting Procedures :AVOID BREATHING HAZARDOUS VAPORS. KEEP UPWIND. Unusual Fire/Explosion Hazard:TOXIC GASES ARE RELEASED DURING COMBUSTION.
======== Accidental Release Measures ==========

Spill Release Procedures: TAKE UP WITH ABSORBENT MATERIAL AND PLACE INTO

========== Handling and Storage ===========

Handling and Storage Precautions: STORE AWAY FROM STRONG OXIDIERS.

CLEAN DRY CONTAINER FOR LATER DISPOSAL.
Neutralizing Agent:NONE SPECIFIED BY MANUFACTURER.

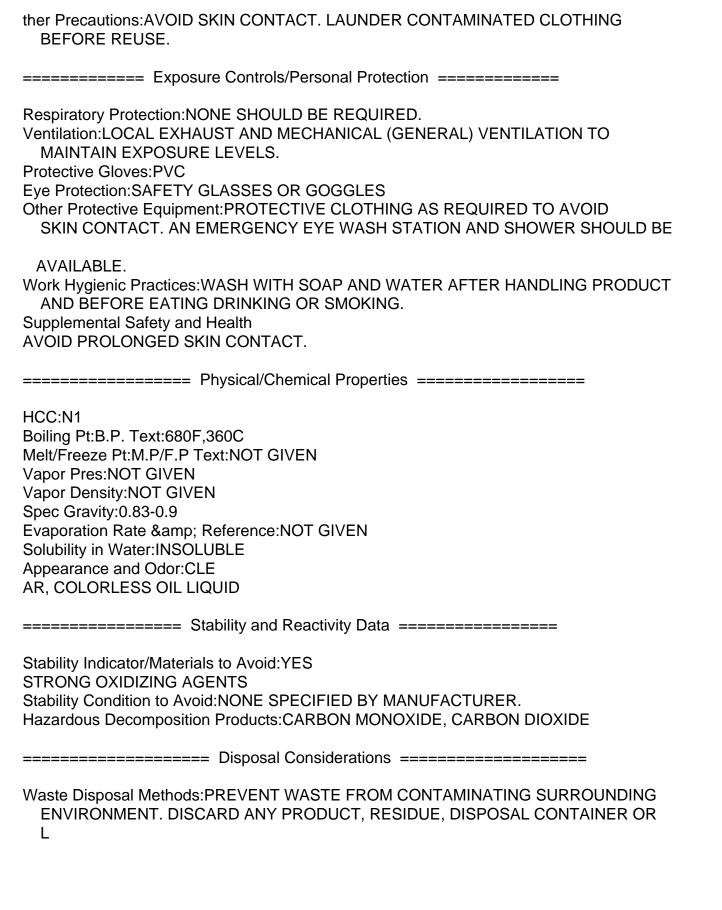

INER IN ACCORDANCE WITH ALL FEDERAL, STATE AND LOCAL REGULATIONS.

Disclaimer (provided with this information by the compiling agencies): This information is formulated for use by elements of the Department of Defense. The United States of America in no manner whatsoever, expressly or implied, warrants this information to be accurate and disclaims all liability for its use. Any person utilizing this document should seek competent professional advice to verify and assume responsibility f or the suitability of this information to their particular situation.